

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

## Document Information

Vehicles affected: P14: 720S Coupe, 720s Spider

Location: Body BIW - Panels

Topic: Rear Bodyside Lower Panel Misalignment

Condition: Permanent

Diagnostic Trouble Codes: N/A

## Measure

Under hot temperature conditions (engine temperature and/or ambient temperature) the rear bodyside lower panel can get deformed/misaligned to the rest of the body side as shown in the picture below. Follow the steps outlined in this document to correct this condition.





1. Remove the rear bodyside lower panel as per SIS instructions DA-RM-02A051-03-002 - Remove/Install bodyside - Lower
2. Ensure all clips to the bodyside are secure. Replace if required.
3. Inspect all 3 bolts to ensure correct length (M6 x 12). If the rear bolt is longer this may result clashing with the rear bodyside lower panel.
4. Install the panel and ensure the correct torque is used as per SIS. Excessive torque may cause panel deformation.

## Parts Information

N/A

## Attachments

N/A

## KA Updates Information

21/04/2021 - Template Updated

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.