

## Document Information

**Location:** Powertrain Transmission – Transmission Electronics

**Topic:** TCU cannot be reprogrammed via the MDS

**Condition:** Permanent

### Diagnostic Trouble Codes

N/A

## Measure

If you experience issues with reprogramming of the TCU, follow the steps below;

1. Switch the ignition to state 5.
2. Operate the Hazard lights.
3. Then press the Start/Stop button once (this will drop the ignition to state 2).
4. Go TCU reprogramming page.
5. Start the reprogramming with the software that the MDS currently offers.
6. If the reprogramming fails, record the stage when it fails.
7. Repeat steps 1 - 5.
8. If reprogramming is completed, switch the ignition back to state 5.
9. Rescan the vehicle.
10. Then go to TCU Sequences and perform program VIN

If you are still having the same issue, please raise a Technical Request.

## Parts Information

N/A

## Warranty Information

Resolution Category

Casual Part Number: N/A

Casual Part Name: N/A

Casual Issue: N/A

Rectification: N/A

Time: N/A

## Attachments

N/A

## KA Updates Information

N/A

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.