

**This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.**

## Document Information

**Location:** Interior

**Topic:** Seat back rework instructions in the event that the upholstery has detached from the frame assembly

**Condition:** Permanent

**Diagnostic Trouble Codes:** N/A

## Measure

In the event that the seat back upholstery becomes detached from the frame assembly, please refer to the following rework instructions.

Where drawstrings are not present, seat edge trim clips are used as part of the seat structure. These are available within MSP and can be installed in place of the originals, providing a secure refitment of the seat upholstery.

1. Remove the affected seat and place on a stable surface. Recline the backrest as shown



2. Remove all clips from the upholstery recess as clips no longer provide desired levels of security and fitment



3. Replace all clips with new, evenly spacing around the recess

4. Use a suitable tool to press new clips into the upholstery recess

5. Fold upholstery trim guide into the upholstery recess of the seat back and position within the new retaining clips



6. Using a suitable tool, apply pressure and manipulation to secure upholstery trim guide within new retaining clips



7. Confirm successful engagement within the retaining clips by applying moderate pressure away from the recess



8. Install removed seat

## Parts Information

## Repair Time

N/A

## Attachments

N/A

**This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.**