

McLaren 720S – WCAC Hose to CCV Pipe Clash Rework


Bulletin type: Service Campaign Bulletin
Reference number: SCB14 L 001
Campaign reference: 04U
Attention: Retailer Service Managers and Retailer Technicians
Affected vehicles: 720S; Coupe and Spider
Situation: Potential for Insufficient gap tolerance between components
Procedure: To action affected vehicles during next Retailer visit.
Please refer to the information outlined in this document to ensure sufficient gap tolerance is created between mentioned components
Date: 5th September 2019

This Service Campaign Bulletin will cover:

1. Overview
2. Procedure
3. Parts Information
4. Warranty Information
5. Affected Vehicles

1. Overview

McLaren Automotive has identified through continuous product quality monitoring, that a number of McLaren 720S vehicles (Coupe and Spider versions) may have an insufficient gap tolerance between the Water Charge Air Cooler (WCAC) hose and Crankcase ventilation pipe (CCV). This could cause a clash condition and subsequent damage to the components.

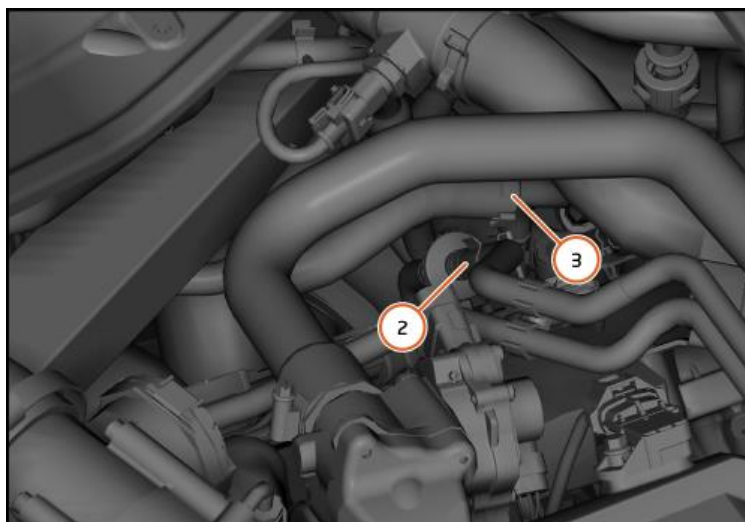

Layout overview - CCV pipe (2), WCAC hose (3)

2. Procedure

To carry out the required re-work, installation of a double 'C' clip is required which will increase the gap tolerance and prevent further potential clashes.

Document SCB 14 L 001 WI (attached with this bulletin), contains the relevant work instruction and care points to ensure the required repair is carried out to bring the vehicle up to the current manufacturing standard.

3. Parts Information

The parts below are required to action this repair, which can be ordered via Unipart.

Part Number	Part Description	Quantity Required
00RB007 (Unit of Purchase is 10)	26 x 27.8mm Modular Pipe Clip - Female	1
00RB034 (Unit of Purchase is 15)	14-15mm 90° clip - male	1

4. Warranty Information

Description	Resolution Code	Repair Time
McLaren 720S - WCAC Hose to CCV Pipe Clash Rework - Vehicle is in Retailer for Service	CPCPC412A11C2J02	0.55 hours
McLaren 720S - WCAC Hose to CCV Pipe Clash Rework - Vehicle is in Retailer for Non-Service Repair	CPCPC412A11C2J02	0.05 hours*

* In cases where the campaign is completed on non-service repair vehicles, please add an additional labour line for 0.05 hours.

CARE POINT: Where campaign "14 L 002 WCAC Pipe to HVAC Pipe Clash Rework" is completed during the same visit, the additional time must only be added to one campaign claim.

5. Affected Vehicles

Your Regional Aftersales Manager will contact you with a list of affected vehicles.

If you have any questions, please speak to your Regional Aftersales Manager.

Best regards,

Part numbers listed in McLaren bulletins are for reference only. Always check with the parts department to verify the latest part numbers.

All bulletins (Information/Campaign/Recall) issued by McLaren Automotive Limited ("McLaren") are intended only for use by technicians who have attended McLaren technical training courses. McLaren trained technicians have the equipment, tools, safety instructions and the know how to perform the job properly and safely. McLaren bulletins are written to inform McLaren technicians of conditions that may occur on some McLaren vehicles, or to provide information that could assist diagnosing a McLaren vehicle. Part numbers listed in McLaren bulletins are for reference only. Always check with the parts department to verify the latest part numbers.