

# McLaren 720S – WCAC Pipe to HVAC Pipe Clash Rework


**Bulletin type:** Service Campaign Bulletin  
**Reference number:** SCB14 L 002  
**Campaign reference:** 04V  
**Attention:** Retailer Service Managers and Retailer Technicians  
**Affected vehicles:** McLaren 720S; Coupe and Spider  
**Situation:** Potential for insufficient gap tolerance between components  
**Procedure:** To action affected vehicles during next Retailer visit  
Please refer to the information outlined in this document to ensure sufficient gap tolerance is created between mentioned components  
**Date:** 5<sup>th</sup> September 2019

This Service Campaign Bulletin will cover:

1. Overview
2. Procedure
3. Parts Information
4. Warranty Information
5. Affected Vehicles

## 1. Overview

McLaren Automotive has identified through our continuous product quality monitoring, that several McLaren 720S vehicles (Coupe and Spider versions) may have an insufficient gap tolerance between a Water Charge Air Cooler (WCAC) pipe and Heating Ventilation Air Conditioning (HVAC) pipe. This could cause a clash condition and subsequent damage to the components.

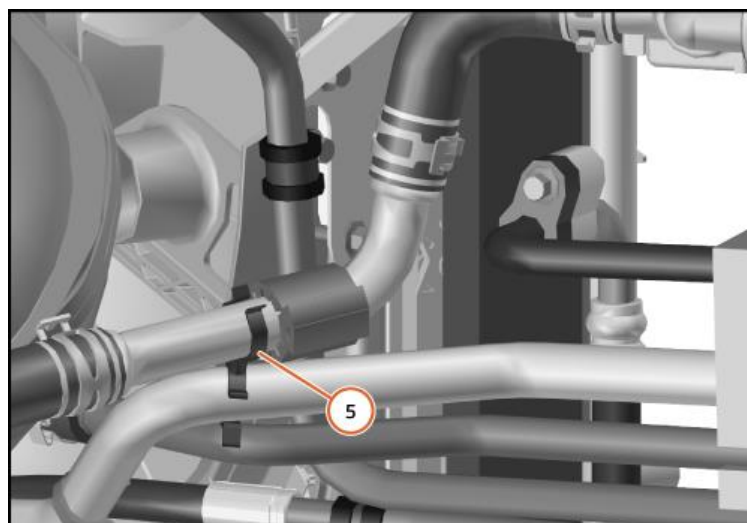

Layout overview - Install clip assembly (5) and move pipe protector

## 2. Procedure

To carry out the required re-work, repositioning of the existing pipe protector is required along with installation of a double 'C' clip which will increase the gap tolerance and prevent further potential clashes.

Document SCB14 L 002 WI (attached with this bulletin), contains the relevant work instruction and care points to ensure the required repair is carried out to bring the vehicle up to the current manufacturing standard.

## 3. Parts Information

The parts below are required to action this repair, which can be ordered via Unipart.

Part Number	Part Description	Quantity Required
0ORB007 (Unit of Purchase is 10)	26 x 27.8mm Modular Pipe Clip - Female	1
0ORB008 (Unit of Purchase is 10)	18-20mm Clip - Male	1

## 4. Warranty Information

Description	Resolution Code	Repair Time
McLaren 720S - WCAC Pipe to HVAC Pipe Clash Rework - Vehicle is in Retailer for Service	CPCPC414A11C2J02	0.1 hours
McLaren 720S - WCAC Pipe to HVAC Pipe Clash Rework - Vehicle is in Retailer for Non-Service Repair	CPCPC414A11C2J02	0.35 hours*

\* In cases where the campaign is completed on non-service repair vehicles, please add an additional labour line for 0.35 hours.

**CARE POINT:** Where campaign "14 L 001 WCAC Hose to CCV Pipe Clash Rework" is completed during the same visit, the additional time must only be added to one campaign claim.

## 5. Affected Vehicles

Your Regional Aftersales Manager will contact you with a list of affected vehicles.

If you have any questions, please speak to your Regional Aftersales Manager.

Best regards,

The information contained in McLaren bulletins is for internal use only by McLaren Authorised Retailers and must not be published on external websites or social media forums etc.

Part numbers listed in McLaren bulletins are for reference only. Always check with the parts department to verify the latest part numbers.

All bulletins (Information/Campaign/Recall) issued by McLaren Automotive Limited ("McLaren") are intended only for use by technicians who have attended McLaren technical training courses. McLaren trained technicians have the equipment, tools, safety instructions and the know how to perform the job properly and safely. McLaren bulletins are written to inform McLaren technicians of conditions that may occur on some McLaren vehicles, or to provide information that could assist diagnosing a McLaren vehicle. Part numbers listed in McLaren bulletins are for reference only. Always check with the parts department to verify the latest part numbers.