

# Pipe Protector and Clip Installation

**Bulletin type:** Service Campaign  
**Reference number:** N/A  
**Campaign reference:** SCB 00 F 001  
**Attention:** Retailer Aftersales Managers, Retailer Service Managers, Retailer Service Advisors, Retailer Technicians, Retailer Parts Managers  
**Affected vehicles:** McLaren 720S, McLaren 765LT, McLaren GT  
**Situation:** Installation of pipe protectors and clip to the WCAC Inlet  
**Procedure:** Action affected vehicles during PDI and those immediately available at the Retailer premises (including stock, demo and showroom vehicles). Please refer to the information outlined in this document to complete the required work  
**Date:** 6<sup>th</sup> August 2025

This bulletin will cover:

- 
1. Overview
  2. Parts Information
  3. Procedure
  4. Warranty Information
  5. Affected Vehicles
- 

## 1. Overview

Through continuous product quality monitoring, McLaren Automotive has identified that on some McLaren 720S, McLaren 765LT and McLaren GT vehicles, the clearance between the WCAC inlet pipe and the top hose varies between vehicles. To ensure these vehicles are up to standard, McLaren Automotive is instructing Retailers to install pipe protectors and a C-clip onto the WCAC inlet pipe.

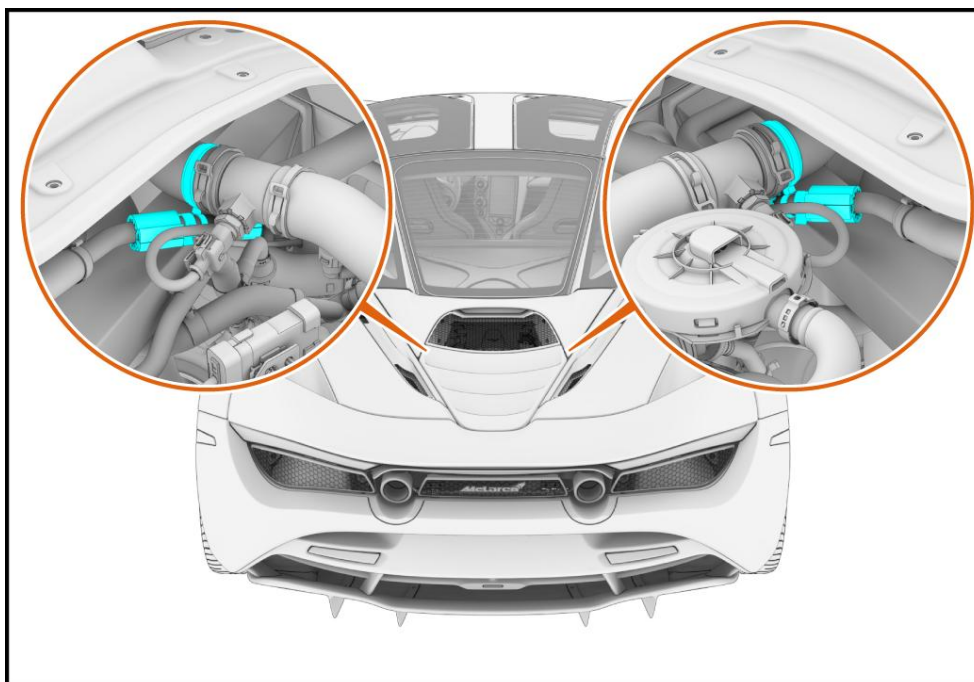


Image 1: Overview of the installation location

## 2. Parts Information

The below parts are required to action the installation of the pipe protectors and clip. All parts below are available to order via Unidial 2.

Part Number	Part Description	Quantity Required
00RA357	PIPE PROTECTOR	4
00RB057	CLIP-39-45MM-FEMALE	2
00RB023	CLIP SPACER-1MM-MALE	2
00RB120	CLIP-90 DEGREE-FEMALE-20-22	2

All orders should be placed on Unidial 2, for any parts queries please contact our Parts Customer Service Team:  
 EMEA – [mclarencustomerservice@unipart.com](mailto:mclarencustomerservice@unipart.com)  
 APACHI – [mclarencustomerserviceap@unipart.com](mailto:mclarencustomerserviceap@unipart.com)  
 AMERICAS – [mclarencustomerservicena@unipart.com](mailto:mclarencustomerservicena@unipart.com)

**Care Point:** When placing the order on Unidial 2, using the **UK warehouse**, order a **minimum** of 5 vehicle sets. The unit of issue (UOI) for the parts required for this Service Campaign is a minimum of 10 per part.

To support timely completion of Campaigns, please plan your parts ordering in line with your impacted Vehicle Parc.

Sufficient inventory in your facility to complete your vehicle Campaigns will build customer trust and promotes customer satisfaction. In turn, we are doing everything possible to best support you with the right stock in our central facilities so we can ship your orders quickly.

## 3. Procedure

To carry out the required work to install the pipe protectors and clip for this Service Campaign, follow McLaren Service Portal (MSP) D055268 “Rework – High Temperature Radiator (HTR) Top Hose to Water Charge Air Cooler (WCAC) Inlet Pipe” work instruction.

## 4. Warranty Information

Submit a claim to the McLaren Warranty department following completion of the work, using the following details.

Description	Repair Time
Pipe Protector and Clip Installation – 720S Coupe	0.50 hrs
Pipe Protector and Clip Installation – 720S Spider	0.85 hrs
Pipe Protector and Clip Installation – 765LT Coupe	0.55 hrs
Pipe Protector and Clip Installation – 765LT Spider	0.85 hrs
Pipe Protector and Clip Installation – GT	1.45 hrs

## 5. Affected Vehicles

Affected vehicles will be flagged in the Retailer Portal when next opening a Workshop Visit related to the vehicle. Your Regional Aftersales Manager will also contact you with a VIN list of affected vehicles.

If you have any questions, please speak to your Regional Aftersales Manager.

The information contained in McLaren bulletins is for internal use only by McLaren Authorised Retailers and must not be published on external websites or social media forums etc.

The McLaren data classification policy applies to all full time, part-time and fixed term employees of McLaren and all workers including, contractors, consultants, suppliers, and third parties who have access to McLaren data and/or systems. This policy includes all information held by, or on behalf of, McLaren in any form and all information systems/services used by, or used to store data belonging to, McLaren.

Part numbers listed in McLaren bulletins are for reference only. Always check with the parts department to verify the latest part numbers.

All bulletins (Information/Campaign/Recall) issued by McLaren Automotive Limited ("McLaren") are intended only for use by technicians who have attended McLaren technical training courses. McLaren trained technicians have the equipment, tools, safety instructions and the know how to perform the job properly and safely. McLaren bulletins are written to inform McLaren technicians of conditions that may occur on some McLaren vehicles, or to provide information that could assist diagnosing a McLaren vehicle. Part numbers listed in McLaren bulletins are for reference only. Always check with the parts department to verify the latest part numbers.